

ProLED® Linear LED WRAP Installation Instructions



Part No.	Input voltage (V)	Watt (W)	Input Current (A)	CCT	Efficiency (LM/W)	Power factor	CRI	Dimension (mm)	Expected service life
10299	120-277V ac 50/60Hz	40	0.33-0.14	4000K	> 110	>0.9	>80	617X166X64.5	> 5 years
10302	120-277V ac 50/60Hz	20	0.17-0.07	4000K	> 110	>0.9	>80	1237X166X64.5	> 5 years
10304	120-277V ac 50/60Hz	40	0.33-0.14	5000K	>110	>0.9	>80	617X166X64.5	> 5 years
10307	120-277V ac 50/60Hz	20	0.17-0.07	5000K	> 110	>0.9	>80	1237X166X64.5	> 5 years

READ CAREFULLY BEFORE INSTALLING FIXTURE. RETAIN THESE INSTRUCTIONS FOR FUTURE REFERENCE.

Fixtures must be wired in accordance with the National Electrical Code and all applicable local codes. Proper grounding is required for safety. THIS PRODUCT MUST BE INSTALLED IN ACCORDANCE WITH THE APPLICABLE INSTALLATION CODE BY A PERSON FAMILIAR WITH THE CONSTRUCTION AND OPERATION OF THE PRODUCT AND THE HAZARDS INVOLVED.

0-10V DIMMABLE WIRING

Universal voltage driver permits operation at 120V thru 277V, 50 or 60 Hz. For 0-10V Dimming, follow the wiring directions in **Fig. 4**.

1. Connect the black fixture lead to the LINE supply lead.
2. Connect the white fixture lead to the COMMON supply lead.
3. Connect the GROUND wire from fixture to supply ground. Do NOT connect the GROUND of the dimming fixture to the output.
4. Connect the purple fixture lead to the (V+) DIM lead.
5. Connect the gray fixture lead to the (V-) DIM lead.
6. Cap the yellow fixture lead, if present. Do NOT connect.

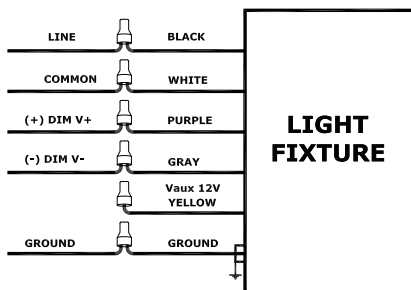


Fig. 4

CLEANING & MAINTENANCE

CAUTION: Be sure fixture temperature is cool enough to touch. Do not clean or maintain while fixture is energized.

1. Clean polycarbonate lens with non-abrasive cleaning solution.
2. Do not open the fixture to clean the LEDs. Do not touch the LEDs.

TROUBLESHOOTING


1. Check that the line voltage at the fixture is correct. Refer to wiring directions.
2. Be sure the fixture is grounded properly.

Linear LED WRAP Installation Instructions

SURFACE MOUNTING

The fixture is suitable for indoor applications for ceiling or wall mounting. Mount to a recessed octagonal junction box as follows:

1. Carefully snap out **Lens** one side at a time from **Housing**.
2. Pull supply wires from Junction Box through **Center Access Hole** of **Housing** as shown in in right Fig. Use appropriate UL approved wire connectors as required by code to make electrical splices to fixture leads.
3. Secure **Housing** to junction box or mount **Housing** directly to sturdy surface by using the **Drill Locations** Use the appropriate mounting hardware for the mounting surface.
4. Once connections are made push all wires in housing.
5. Be careful not to pinch wires. Hook **Lens** to one side of **Housing** and Snap **Lens** into place.

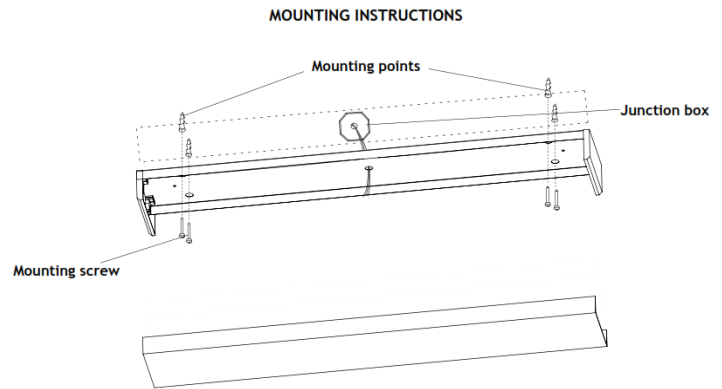

WARNING: To prevent wiring damage or abrasion, do not expose wiring to edges of sharp objects.