

## Color Selectable LED Flat-Back Track Head

#### DESCRIPTION

Reduce energy and maintenance costs by replacing existing HALO track heads with these more efficient color selectable LED flat-back track heads.

#### **FEATURES**

- Energy efficient replacement for 75W PAR30 halogen lamps
- High color rendering index (CRI) of 90 helps makes colors appear brighter and more vivid
- Compatible with HALO single and dual circuit track
- Arm can spin up to 350-degrees vertically; head can be adjusted up to 90-degrees horizontally
- Dimmable; see dimmer compatibility sheet for full list of compatible dimmers
- Color temperature can be adjusted via switch on back of fixture; see installation instructions for more information

#### LISTINGS

ETL Listed for indoor/dry locations

### PERFORMANCE

CRI: 90

CCT: 3000K, 4000K, and 5000K
LED L70 Life Hours: ≥100,000 hours

### **ELECTRICAL**

Power Factor: >0.89

• THD: <50%

Input Voltage: 120V

#### CONSTRUCTION

- Aluminum housing with black finish
- Polycarbonate lens

project name	type
catalog number	
comments	voltage
approved by	date





## WARRANTY

 3 year limited warranty; see pltsolutions.com for warranty details

## **APPLICATIONS**


- Offices
- Lobbies
- Kitchens
- Art Galleries

	Power Consumption	12 Watt		
PERFORMANCE	Lumens	880		
	Efficacy (LPW)	73		
	CRI	90		
	сст	3000K, 4000K, 5000K		
	LED L70 Life Hours	≥100,000		
	Beam Angle	36°		
	Power Factor	>0.89		
ELECTRICAL	THD	<50%		
	Input Voltage	120V		
CONSTRUCTION	Finish	Black		
CONSTRUCTION	Lens	Clear		
LISTINGS	Certifications	ETL		
CISTINGS	Environment	Indoor/Dry Locations		

## PERFORMANCE SUMMARY

Item#	Lumens	Wattage	LPW	Voltage	Replaces	ССТ	CRI	LED L70 Life Hours	Dimmable
PLTS-12270	880	12	73	120V	75W Halogen	3000K/ 4000K/ 5000K	90	≥100,000	Yes

## DIMENSIONS

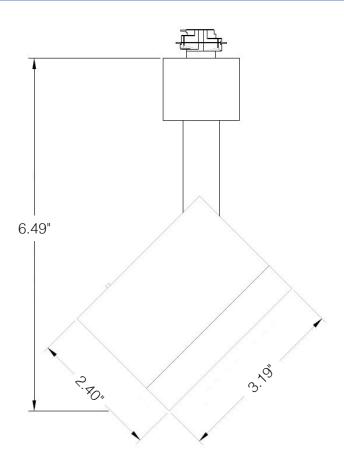

## DIMENSIONS

Length: 2.40"

Height (with arm): 6.49"

Width: 3.19"

Weight: 0.59 lbs

Arm Length: 3.15"

# **WARNINGS**

 Only use this LED track light head with the dimmers listed in the compatibility list. Using this downlight with incompatible dimmers may cause performance issues including humming, buzzing, flickering, and poor dimming performance.