

## DESCRIPTION

Reduce energy and maintenance costs by replacing existing HALO track heads with these more efficient color selectable LED step cylinder track heads.

## FEATURES

- Energy efficient replacement for 75W PAR30 halogen lamps
- High color rendering index (CRI) of 90 helps makes colors appear brighter and more vivid
- Compatible with HALO single and dual circuit track
- Arm can spin up to 350-degrees vertically; head can be adjusted up to 90-degrees horizontally
- Dimmable; see dimmer compatibility sheet for full list of compatible dimmers
- Color temperature can be adjusted via switch on arm of fixture; see installation instructions for more information

## LISTINGS

- ETL Listed for indoor/dry locations

## PERFORMANCE

- CRI: 90
- CCT: 3000K, 4000K, and 5000K
- LED L70 Life Hours: ≥100,000 hours

## ELECTRICAL

- Power Factor: >0.89
- THD: <50%
- Input Voltage: 120V

## CONSTRUCTION

- Aluminum housing with white finish
- Polycarbonate lens

project name	type
catalog number	
comments	voltage
approved by	date



## WARRANTY

- 3 year limited warranty; see [pltsolutions.com](http://pltsolutions.com) for warranty details

## APPLICATIONS


- Offices
- Lobbies
- Kitchens
- Art Galleries

<b>PERFORMANCE</b>	Power Consumption	10 Watt
	Lumens	750
	Efficacy (LPW)	75
	CRI	90
	CCT	3000K, 4000K, 5000K
	LED L70 Life Hours	≥100,000
	Beam Angle	36°
<b>ELECTRICAL</b>	Power Factor	>0.89
	THD	<50%
	Input Voltage	120V
<b>CONSTRUCTION</b>	Finish	White
	Lens	Clear
<b>LISTINGS</b>	Certifications	ETL
	Environment	Indoor/Dry Locations

## PERFORMANCE SUMMARY

Item #	Lumens	Wattage	LPW	Voltage	Replaces	CCT	CRI	LED L70 Life Hours	Dimmable
PLTS-12278	750	10	75	120V	75W Halogen	3000K/ 4000K/ 5000K	90	≥100,000	Yes

## DIMENSIONS

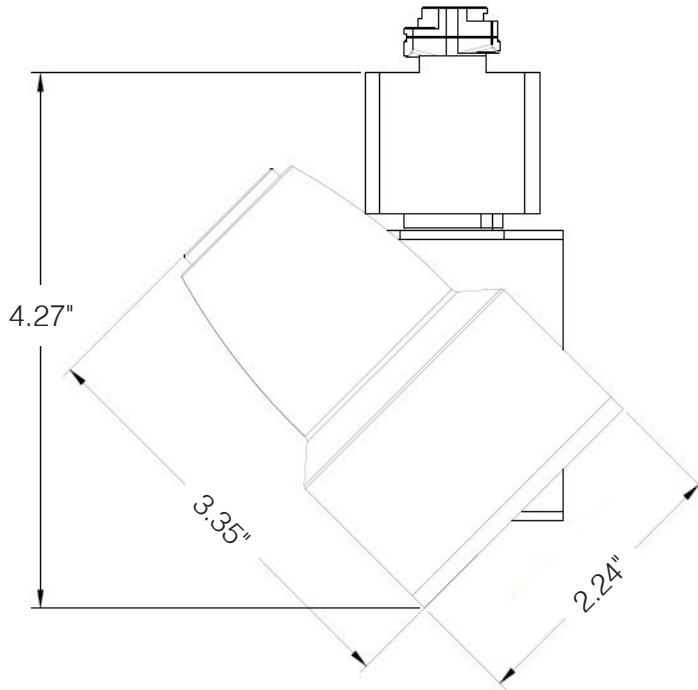

### **DIMENSIONS**

Length: 3.35"

Height (with arm): 4.27"

Width: 2.24"

Weight: 0.69 lbs

Arm Length: 3.80"

## WARNINGS

- Only use this LED track light head with the dimmers listed in the compatibility list. Using this downlight with incompatible dimmers may cause performance issues including humming, buzzing, flickering, and poor dimming performance.