

# Color Selectable LED Flat-Back Track Head

#### DESCRIPTION

Reduce energy and maintenance costs by replacing existing HALO track heads with these more efficient color selectable LED flat-back track heads.

#### **FEATURES**

- Energy efficient replacement for 90W PAR38 halogen lamps
- High color rendering index (CRI) of 90 helps makes colors appear brighter and more vivid
- Compatible with HALO single and dual circuit track
- Arm can spin up to 350-degrees vertically; head can be adjusted up to 90-degrees horizontally
- Dimmable; see dimmer compatibility sheet for full list of compatible dimmers
- Color temperature can be adjusted via switch on arm of fixture; see installation instructions for more information

#### LISTINGS

ETL Listed for indoor/dry locations

#### PERFORMANCE

• CRI: 90

CCT: 3000K, 4000K, and 5000K
 LED L70 Life Hours: ≥100,000 hours

#### **ELECTRICAL**

Power Factor: >0.86

• THD: <50%

Input Voltage: 120V

#### CONSTRUCTION

- Aluminum housing with white finish
- Polycarbonate lens

project name	type
catalog number	
comments	voltage
approved by	date





# WARRANTY

 5-year limited warranty; see pltsolutions.com for warranty details

### **APPLICATIONS**


- Offices
- Lobbies
- Kitchens
- Art Galleries

	Power Consumption	18 Watt		
PERFORMANCE	Lumens	1600		
	Efficacy (LPW)	89		
	CRI	90		
	сст	3000K, 4000K, 5000K		
	LED L70 Life Hours	≥100,000		
	Beam Angle	36°		
ELECTRICAL	Power Factor	>0.86		
	THD	<50%		
	Input Voltage	120V		
CONSTRUCTION	Finish	White		
	Lens	Clear		
LISTINGS	Certifications	ETL		
	Environment	Indoor/Dry Locations		

# PERFORMANCE SUMMARY

Item #	Lumens	Wattage	LPW	Voltage	Replaces	ССТ	CRI	LED L70 Life Hours	Dimmable
PLTS-12273	1600	18	89	120V	90W Halogen	3000K/ 4000K/ 5000K	90	≥100,000	Yes

# DIMENSIONS

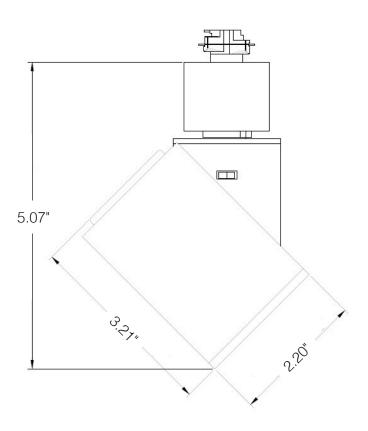

# **DIMENSIONS**

Length: 3.21"

Height (with arm): 5.07"

Width: 2.20"

Weight: 0.72 lbs
Arm Length: 4.56"

# **WARNINGS**

 Only use this LED track light head with the dimmers listed in the compatibility list. Using this downlight with incompatible dimmers may cause performance issues including humming, buzzing, flickering, and poor dimming performance.